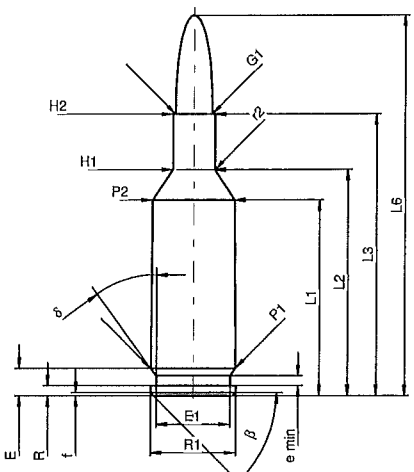
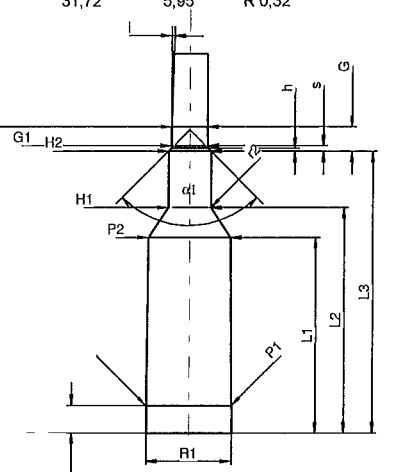


C.I.P.		5 mm /35 SMc		TAB.																																		
				I																																		
		Ursprungsland: US		Datum	09-05-05																																	
				Revision																																		
<table border="1"> <thead> <tr> <th>L</th> <th>P</th> <th>α</th> </tr> </thead> <tbody> <tr><td>27,51</td><td>11,60</td><td>46,36</td></tr> <tr><td>27,99</td><td>11,15</td><td>53,24</td></tr> <tr><td>28,52</td><td>10,62</td><td>58,00</td></tr> <tr><td>29,03</td><td>10,02</td><td>63,38</td></tr> <tr><td>29,54</td><td>9,23</td><td>69,58</td></tr> <tr><td>30,05</td><td>8,60</td><td>76,90</td></tr> <tr><td>30,56</td><td>7,73</td><td>85,86</td></tr> <tr><td>31,06</td><td>6,66</td><td>97,34</td></tr> <tr><td>31,57</td><td>5,97</td><td>105,84</td></tr> <tr><td>31,72</td><td>5,92</td><td>R 0,32</td></tr> </tbody> </table> 		L	P	α	27,51	11,60	46,36	27,99	11,15	53,24	28,52	10,62	58,00	29,03	10,02	63,38	29,54	9,23	69,58	30,05	8,60	76,90	30,56	7,73	85,86	31,06	6,66	97,34	31,57	5,97	105,84	31,72	5,92	R 0,32	PATRONE MAXI <p>Längen</p> L1 1) = 27.51 -0.20 L2 1) = 31.72 -0.20 L3 1) = 39.52 L4 = L5 = L6 = 53.34 <p>Hülsenboden</p> R = 1.37 R1 = 12.01 R3 = E = 3.85 E1 = 10.39 e min = 1.40 δ = 36° f = 0.40 β = 45° <p>Pulverkammer</p> P1 = 11.96 P2 1)* = 11.60 -0.20 <p>Schulterkonus</p> α = S = r1 min = r2 = 0.32 <p>Hülshals</p> H1 * = 5.95 H2 1) = 5.94 <p>Geschoss</p> G1 1) = 5.18 G2 = F = L3+G 1) = 44.75 <p>Drücke (Energien)</p> Mech. elektr. Wandler Pmax = 4400 bar PK = 5060 bar PE = 5500 bar M = 17.50 EE = 1650 Joule <p>Verschiedene Daten</p> Fe 1)3) = 0.10 delta L =		PATRONELAGER MINI <p>Längen</p> L1 = 27.51 L2 = 31.72 L3 1) = 39.65 <p>Stoßboden</p> R = R1 = 12.04 R2 = R3 = r = <p>Pulverkammer</p> E = 3.85 P1 1) = 11.99 P2 * = 11.63 <p>Schulterkonus</p> α = S = r1 max = r2 = 0.32 <p>Hülshals</p> H1 * = 5.97 H2 1) = 5.97 <p>Geschossübergang</p> G1 1)* = 5.19 G 1) = 3.43 α 1 = 90° h = 0.38 s * = 0.76 i 1)* = 1°30' <p>Lauf</p> F 1)* = 5.05 Z 1) = 5.18 <p>Züge</p> b = 1.30 N = 6 u = 305.00 Q = 20.54 mm ²	
L	P	α																																				
27,51	11,60	46,36																																				
27,99	11,15	53,24																																				
28,52	10,62	58,00																																				
29,03	10,02	63,38																																				
29,54	9,23	69,58																																				
30,05	8,60	76,90																																				
30,56	7,73	85,86																																				
31,06	6,66	97,34																																				
31,57	5,97	105,84																																				
31,72	5,92	R 0,32																																				
<table border="1"> <thead> <tr> <th>L</th> <th>P</th> <th>α</th> </tr> </thead> <tbody> <tr><td>27,51</td><td>11,63</td><td>46,36</td></tr> <tr><td>27,99</td><td>11,15</td><td>53,24</td></tr> <tr><td>28,52</td><td>10,62</td><td>58,00</td></tr> <tr><td>29,03</td><td>10,02</td><td>63,38</td></tr> <tr><td>29,54</td><td>9,23</td><td>69,58</td></tr> <tr><td>30,05</td><td>8,60</td><td>76,90</td></tr> <tr><td>30,56</td><td>7,73</td><td>85,86</td></tr> <tr><td>31,06</td><td>6,66</td><td>97,34</td></tr> <tr><td>31,57</td><td>5,97</td><td>105,84</td></tr> <tr><td>31,72</td><td>5,95</td><td>R 0,32</td></tr> </tbody> </table> 		L	P	α	27,51	11,63	46,36	27,99	11,15	53,24	28,52	10,62	58,00	29,03	10,02	63,38	29,54	9,23	69,58	30,05	8,60	76,90	30,56	7,73	85,86	31,06	6,66	97,34	31,57	5,97	105,84	31,72	5,95	R 0,32				
L	P	α																																				
27,51	11,63	46,36																																				
27,99	11,15	53,24																																				
28,52	10,62	58,00																																				
29,03	10,02	63,38																																				
29,54	9,23	69,58																																				
30,05	8,60	76,90																																				
30,56	7,73	85,86																																				
31,06	6,66	97,34																																				
31,57	5,97	105,84																																				
31,72	5,95	R 0,32																																				
Maßstab 1:1																																						
Maße in << mm >> Maße und Toleranzen für Messläufe siehe Anhang CR 1.		Bemerkungen:		1) Kontrolle aus Sicherheitsgründen 3) Verschlussabstand an Schulter * Grundmaße																																		